

Quick Start Guide HXC cameras - Release 2 (Camera Link®)

Download latest camera software:

www.baumer.com/vision/software

Download latest technical documentation:

www.baumer.com/cameras/docs

Conformity / Safety



We declare, under All HXC camerour sole responas comply with sibility that the described Baumer HXC cameras conform with the concerning RoHS Rules directives of the CE.

the recommendation of the European Union

FCC - Class B device

NOTE: This equipment has been tested and found to comply with the limits for a Class B digital device, pursuant to part 15 of the FCC Rules. These limits are designed to provide reasonable protection against harmful interference in a residential environment. This equipment generates, uses, and can radiate radio frequency energy and, if not installed and used in accordance with the instructios, may cause harmful interference to radio communications. However, there is no quarantee that interference will not occure in a particular installation. If this equipment does cause harmful interference to radio or television reception, which can be determined by turning the equipment off an on, the user is encouraged to try to correct the interference by one or more of the following measures:

- Reorient or relocate the receiving antenna.
- Increase the separation between the equipment and the receiver.
- · Connect the equipment into an outlet on a circuit different from that to which the receiver is connected.
- · Consult the dealer or an experienced radio/TV technician for help.

Several of the described Baumer HXC cameras conform with the directives of the Korean Conformity

Please refer for the User's guide or technical documentation

Safety instructions

See User's Guide for the complete safety instructions!

- · Protect the sensor from dirt and
- · Never open the camera housing.
- Avoid camera contamination by foreign objects.

Environmental requirements:

Storage temp.	-10 °C +70 °C
	(14 °F158 °F)
Operating temp.	+5 °C +60 °C
	(41 °F140 °F)
Housing temp.	max. +65 °C
• .	(max. 149 °F)
Humidity	10 % 90 %
•	Non-condensing
	_

Further Information


For further information on our products visit www.baumer.com For technical issues, please contact our technical support: support.cameras@baumer.com Phone +49 (0)3528 4386-0 · Fax +49 (0)3528 4386-86

© Baumer Optronic GmbH · Badstrasse 30 · DE-01454 Radeberg, Germany Technical data has been fully checked, but accuracy of printed cannot be guaranteed Subject to change without notice. Printed in Germany 08/21. v22 **Product Specification**


HXC cameras - Maximum Performance with CMOSIS sensors

- Camera Link® Full progressive scan CMOS camera
- Excellent image quality
- Global shutter architecture for minimized motion blur
- Low noise due to correlated double sampling (CDS)
- HDR (High Dynamic Range)
- Enhanced NIR sensitivity model available
- Binning, subsampling and true partial scan function (ROI) for increased frame
- External synchronization via industrial compliant process interface (trigger / flash)
- Integrated supplementary function for flexible integration
- Integrated 256 MByte RAM for temporarily image data buffering.
- Two standard 26 pin Mini-CameraLink® connectors
- Support for CameraLink® Base. Medium. Full and 10 tap configurations
- Baumer GAPI: Flexible, generic software interface for Windows

Dimensions with F-Mount

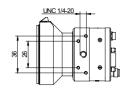



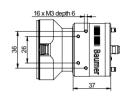





Installation

Installation using Camera Link® BASE:

- Connect the camera using an appropriate cable to the framegrabber board on your PC using the lower sdr-26 iack on the camera side
- If required, connect a strobe to the connector
- · Connect the camera to power supply

Installation using

FULL:

Camera Link® MEDIUM /

· Connect the camera using

two appropriate cables to


requires the BASE and the

FULL Camera Link® line)

to the connector

power supply

· Connect the camera to

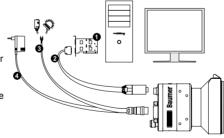

Installation sample

- 1 Framegrabber board; 2 CameraLink® cable;
- 3 Process interface cable: 4 Power cable


the framegrabber board on your PC (this configuration • If required, connect a strobe


Installation sample

- 1 Framegrabber board; 2 CameraLink® cable;
- 3 Process interface cable; 4 Power cable


Dimensions Cameras with C-Mount



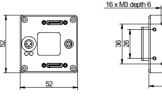


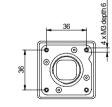



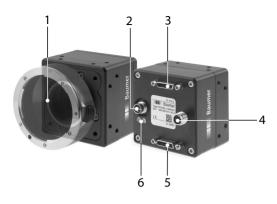

No.	Description	No.	Description
1	(respective) lens mount	4	Digital-IO supply
2	Power supply	5	CameraLink® Base socket
3	Camera Link® Full socket	6	Signaling-LED

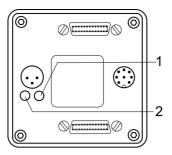


LED	Signal	Meaning
	green	Power on
1	yellow	Readout active
	green	Transmitting
2	red (yellow in both)	Configuration comman processing



Caution

Provide adequate dissipation of heat, to ensure that the temperature does not exceed the spedified temperature.

The surface of the camera may be hot during operation and immediately after use. Be careful when handling the camera and avoid contact over a longer period.

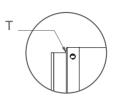

T: Housing temperature measurement point

It is very important to provide adequate dissipation of heat, to ensure that the housing temperature does not reach or exceed +65 °C (+149°F). As there are numerous possibilities for installation, a specific method for proper heat dissipation is not defined, but the following principles are suggested:

- Operate the cameras only in mounted condition with a good heat conductor (e.g. aluminum)
- Mounting in combination with forced convection may provide proper heat dissipation

Camera Link® Interfaces

Notice Saure Type HOLDON (SOURCE) Sine GOODOOX RILD CE

The camera has two Camera Link® sockets. To differentiate between Camera Link® Base and Camera Link® Full socket, please look at the label. You can not use the CL Full socket alone!

Caution

When fixing the Camera Link $^{\tiny (\!0\!)}$ cable with too much force the screws might get damaged.

The maximum torque is 2.5 inch lbf [0.3 Nm].

Base Camera Link®		Full Camera Link®					
			[[] [] [] [] [] [] [] [] [] [
Pin	Signal	Pin	Signal	Pin	Signal	Pin	Signal
1	GND	14	GND	1	GND	14	GND
2	X0-	15	X0+	2	Y0-	15	Y0+
3	X1-	16	X1+	3	Y1-	16	Y1+
4	X2-	17	X2+	4	Y2-	17	Y2+
5	XCLK-	18	XCLK+	5	YCLK-	18	YCLK+
6	X3-	19	X3+	6	Y3-	19	Y3+
7	SERTC+	20	SERTC-	7	100 Ω term.	20	100 Ω term.
8	SERTFG-	21	SERTFG+	8	Z0-	21	Z0+
9	CC1-	22	CC1+	9	Z1-	22	Z1+
10	CC2+	23	CC2-	10	Z2-	23	Z2+
11	CC3-	24	CC3+	11	ZCLK-	24	ZCLK+
12	CC4+	25	CC4-	12	Z3-	25	Z3+
13	GND	26	GND	13	GND	26	GND

Power Supply / IO Pin Assignment (on camera side)

Δ

Caution

A power supply with electrical isolation is required for proper operation of the camera. Otherwise the device may be damaged!

M8 / 3 pins

M8 / 8 pins

wire colors of the connecting cable (ordered separately)





1	(brown)	Power V _{CC}	1	(white)	Line 9
3	(blue)	GND	2	(brown)	Line 1
4	(black)	NC	3	(green)	Line 0
			4	(yellow)	GND
			5	(grey)	U _{ext}
			6	(pink)	Line 7
			7	(blue)	Line 8
			8	(red)	Line 2

Power Supply

Power VCC	9,6 VDC 30 VDC
1	200 mA 625 mA

General notes for electrical Installation

A

Caution

Follow the instructions in the chapter "Hardware installation Procedure" of the User Guide.

Failure to follow the instructions may result in problems during operation and defects in the camera!

ESD precautions:

- · Wear ESD appropriate clothing and shoes
- Perform the installation in an ESD-compliant working environment (conductive floors, grounding strap, ...).
- Never handle the Camera Link connectors without ESD discharge!
- Control the humidity in your environment. Low humidity can cause ESD problems.

Notes on cable routing and avoiding ground loops:

- To avoid ground loops, the power supply cable and the Camera Link cables should be routed in parallel if possible.
- All electrical connections must be brought together at a ground point.
- The ground point should be as close as possible to the frame grabber of the PC.
 The PC must be included in the grounding.
- Avoid laying power supply cables of devices with high current peaks, e.g. motors
 or inverters, parallel to the camera cables.